

2015 - 2017 Corvette Z06: Service Bulletin: #PIP5455A: LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM

#PIP5455A: LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM - (Apr 18, 2017)

Subject:				LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM			
Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	CTS-V	2016 - 2017		All	All	6.2L LT4	All
Chevrolet	Camaro	2017		All	All	6.2L LT4	All
Chevrolet	Corvette	2015 - 2017		All	All	6.2L LT4	All

Involved Region or Country	North America
Additional RPO/s:	6.2 LT4
Condition	<p>There may be a concern with a rattle or flutter noise from the supercharger tensioner and belt. This occurs in V4 mode with light throttle conditions. Issue sounds like tick noise when in driver seat.</p> <p>This seems to vary between vehicles but replacing the tensioner won't resolve the issue.</p>
Cause	The supercharger belt tensioner will jump and cause the noise

Correction

Replace the supercharger belt with a Gates Belt P/N K080852HD

Parts Information

--	--	--

Description	Part Number	Qty
K080852HD	Supercharger Belt	1

Warranty Information

Labor Operation	Description	Labor Time
4062850	Supercharger Belt Replacement	Use Published labor time
	*This is a unique Labor Operation for Bulletin use only.	
<i>Version</i>	2	
<i>Modified</i>	4/18/2017 to update Parts Information	

Online URL: <https://www.corvetteactioncenter.com/tech/knowledgebase/article.php?id=1357>