## 2015 - 2019 Corvette: Service Bulletin: #PIP5784: 8L45 8L90 Automatic Transmissions With No Movement After Valve Body Replacement - (Mar 1, 2021)

## **#PIP5784: 8L45 8L90 Automatic Transmissions With No Movement After Valve Body Replacement - (Mar 1, 2021)**

| Brand:    | Model:                         | Model Year: |      | VIN: |     | Engine: | Transmissi     |
|-----------|--------------------------------|-------------|------|------|-----|---------|----------------|
|           |                                | from        | to   | from | to  |         | on:            |
| Cadillac  | ATS<br>Models                  | 2016        | 2019 | All  | All | All     | M5N M5T<br>M5U |
| Cadillac  | CT4<br>Models                  | 2020        | 2021 | All  | All | All     | M5N            |
| Cadillac  | CT6                            | 2016        | 2018 | All  | All | All     | M5N<br>M5X     |
| Cadillac  | CTS<br>Models                  | 2016        | 2019 | All  | All | All     | M5N<br>M5U     |
| Cadillac  | Escalade<br>Models             | 2015        | 2017 | All  | All | All     | M5U            |
| Chevrolet | Camaro                         | 2016        | 2021 | All  | All | All     | M5T M5U        |
| Chevrolet | Colorado                       | 2017        | 2021 | All  | All | All     | M5T            |
| Chevrolet | Corvette                       | 2015        | 2019 | All  | All | All     | M5U            |
| Chevrolet | Express                        | 2017        | 2021 | All  | All | All     | M5U<br>MQD     |
| Chevrolet | Silverado                      | 2015        | 2018 | All  | All | All     | M5U<br>M5X     |
| Chevrolet | Silverado<br>1500 LD           | 2019        |      | All  | All | All     | MQE            |
| Chevrolet | Silverado<br>1500 Mew<br>Model | 2019        |      | All  | All | All     | MQE            |
| Chevrolet | Silverado<br>1500              | 2020        | 2021 | All  | All | All     | MQE            |
| GMC       | Canyon                         | 2017        | 2021 | All  | All | All     | M5T            |

| GMC               | Savana                      | 2017 | 2021 | All   | All | All | M5U<br>MQD |  |  |
|-------------------|-----------------------------|------|------|---|-----|-----|------------|--|--|
| GMC               | Sierra                      | 2015 | 2018 | All   | All | All | M5U<br>M5X |  |  |
| GMC               | Sierra<br>1500<br>Limited   | 2019 |      | All   | All | All | MQE        |  |  |
| GMC               | Sierra<br>1500 New<br>Model | 2019 |      | All   | All | All | MQE        |  |  |
| GMC               | Sierra<br>1500              | 2020 | 2021 | All   | All | All | MQE        |  |  |
| GMC               | Yukon<br>Denali             | 2015 | 2017 | All   | All | All | M5U        |  |  |
| Involved <b>K</b> | Region or Coun              | try  |      | North America   |     |     |            |  |  |
| Condition         |                             |      |      | Technician's may find a no movement<br>condition after replacement of the valve body<br>on the 8L45 or 8L90 automatic transmission. |     |     |            |  |  |
| Cause             |                             |      |      | This may be due to the incorrect 1-2-7-8-R clutch fluid passage seal being installed or it is missing.                              |     |     |            |  |  |

## Correction

Technician should remove the transmission valve body and inspect for the 1-2-7-8-R clutch fluid passage seal to be installed correctly.

If the 1-2-7-8-R clutch fluid passage seal was installed during the valve body then the technician will need to measure the length of the seal to make sure the correct seal was installed.

The 8L45 seal part number is 24262438 and the seal has no ID notches. This seal is 33.5 MM tall.

The 8L90 seal part number is 24259218 and the seal has 5 ID notches. This seal is 23.1 MM tall.

Version

Modified

03/01/2021 — Created

Online URL:

https://www.corvetteactioncenter.com/tech/knowledgebase/article/2015-2019-corvette-service-bul letin-pip5784-8145-8190-automatic-transmissions-with-no-movement-after-valve-bodyreplacement-mar-1-2021-1493.html