

1968 Corvette: Service Bulletin: Condenser and Receiver-Dehydrator Removal

This General Motors Dealer Service Information Bulletin comes from General Motors Products of Canada Limited. Below is a revised procedure and shop manual update for removal the condenser and receiver-dehydrator on 1968 Corvettes:

| | | | | |
|---------------------------------|--|----------------------------|-----------------|--------------------------------------|
| GENERAL MOTORS | DEALER | SERVICE INFORMATION | BULLETIN | NUMBER: 68-IC-57 |
| | | | | DATE: June 29, 1968. |
| | | | | FILE IN SECTION: Chevrolet |
| GUARDIAN MAINTENANCE | SUBJECT CONDENSER AND RECEIVER-DEHYDRATOR REMOVAL | | | |
| SERVICE | | | | |

TO ALL CHEVROLET DEALERS

Car Line Affected: 1968 Corvette

Condenser Removal

The 1968 Corvette condenser replacement procedure which appears on Page 1A-38 in Part I of the 1968 Shop Manual requires revision. It is not necessary to remove the headlamp actuator assemblies, as stated in Step 3. Once the condenser to radiator support screws have been removed as in Step 6, the condenser and receiver-dehydrator assembly may be removed by tipping the left side up until it clears the left hand actuator assembly, then sliding the right side out from behind the right hand actuator assembly and then up for removal.

Receiver-Dehydrator Removal

The procedure for receiver-dehydrator removal which appears on Page 1A-39 in Part I of the 1968 Shop Manual requires an additional step when applied to the 1968 Corvette. This step entails the removal of the hood from the vehicle. There is not enough clearance to permit receiver-dehydrator removal without first removing the hood. Revise the procedure accordingly.

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1968-corvette-service-bulletin-condenser-and-receiver-dehydrator-removal-1228.html>