

# 1965 Corvette: Service Bulletin: Air Ventilator Control Cables

**Subject:** Air Ventilator Control Cables

**Model and Year:** 1965 Corvette

**Source:** Chevrolet Service Bulletin - #41, Wichita, Kansas Zone

**Bulletin Number:** 9

**Date:** April 7, 1965

On early production Corvettes, difficulty may be experienced in closing the ventilator valves. This could be due to the loosening of the steel tubing at the crimped area of the control cables.

New cable assemblies which incorporate larger crimping areas, entered production approximately 1-4-65.

If the problem is encountered, it can be resolved by replacing the original control cable with the new style cable available for service as listed below.

<u>New Cable</u>	<u>Old Cable</u>	<u>Usage</u>
3874729-30	3857603-4	Cowl Air Vent Control (Exc. A/Cond.)
3874732	3857606	Cowl Air Vent Control (With A/Cond.)
387431	3857605	Roof Vent Valve Control (Exc. A/Cond.)
387433	3857607	Roof Vent Valve Control (With A/Cond.)

Yours very truly,

R.G. Jordan  
Zone Service Manager

---

## Custom Fields

- **Source:** Vette Vues - April 2009 - pg. 108
- 

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1965-corvette-service-bulletin-air-ventilator-control-cables-1250.html>