

2015 - 2019 Corvette: Service Bulletin: #16-NA-361: Information on Transmission Harsh 1-2 Shift Upon First Start Up/Shift of the Day Under Light Throttle

#16-NA-361: Information on Transmission Harsh 1-2 Shift Upon First Start Up/Shift of the Day Under Light Throttle - (Apr 6, 2017)

Subject:				Information on Transmission Harsh 1-2 Shift Upon First Start Up/Shift of the Day Under Light Throttle			
Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	ATS	2016	2017				Automatic 8L45, 8L90 (M5T, M5N, M5U, M5X)
	CTS Models						
	CT6						
	Escalade Models	2015					
Chevrolet	Camaro	2016	2017				
	Corvette	2015	2019				
	Silverado						
GMC	Sierra	2015	2017				
	Yukon						

<i>Involved Region or Country</i>	North America and N.A. Export Regions
<i>Condition</i>	Some customers may comment that the transmission exhibits a harsh 1-2 shift on the first shift of the day, typically under light throttle.
<i>Cause</i>	This condition is due to the initial clutch fill

	time of the 2-3-4-6-8 (C4) clutch.
<i>Information</i>	Some customers may experience a flare condition on the first 1-2 shift of the day or after the vehicle has been parked for several hours. The condition may have developed after the replacement of a complete transmission assembly or the replacement of the stator support to correct a delayed engagement condition. This is most likely to occur under light throttle conditions. Subsequent 1-2 shifts have acceptable shift feel. Replacing transmission components will not correct the condition.
<i>Correction</i>	<p>Important: Replacing transmission components or complete assemblies will not improve the condition.</p> <p>The first 1-2 shift of the day may be harsh. The customers' vehicle should be compared to a like vehicle under the same driving conditions. <i>Do Not</i> replace any parts for this condition.</p> <p>Note: This condition will not impact the designed performance or reliability of the vehicle.</p>

<i>Version</i>	3
<i>Modified</i>	<p>Nov. 18, 2016 - Revised the Cause section.</p> <p>April 6, 2017 - Added models and Revised the Condition, Cause and Correction sections.</p>

Online URL:
<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2015-2019-corvette-service-bul>

[letin-16-na-361-information-on-transmission-harsh-1-2-shift-upon-first-start-up-shift-of-the-day-under-light-throttle-1354.html](http://www.fishbase.org/abstract/2016/16-na-361-information-on-transmission-harsh-1-2-shift-upon-first-start-up-shift-of-the-day-under-light-throttle-1354.html)