

# 2015 - 2017 Corvette Z06: Service Bulletin: #PIP5455A: LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM

## #PIP5455A: LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM - (Apr 18, 2017)

<b>Subject:</b>				LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM			
Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	CTS-V	2016 - 2017		All	All	6.2L LT4	All
Chevrolet	Camaro	2017		All	All	6.2L LT4	All
Chevrolet	Corvette	2015 - 2017		All	All	6.2L LT4	All

<b>Involved Region or Country</b>	North America
<b>Additional RPO/s:</b>	6.2 LT4
<b>Condition</b>	<p>There may be a concern with a rattle or flutter noise from the supercharger tensioner and belt. This occurs in V4 mode with light throttle conditions. Issue sounds like tick noise when in driver seat.</p> <p>This seems to vary between vehicles but replacing the tensioner won't resolve the issue.</p>
<b>Cause</b>	The supercharger belt tensioner will jump and cause the noise

### Correction

Replace the supercharger belt with a Gates Belt P/N K080852HD

### Parts Information

--	--	--

Description	Part Number	Qty
K080852HD	Supercharger Belt	1

### Warranty Information

Labor Operation	Description	Labor Time
4062850	Supercharger Belt Replacement	Use Published labor time
	*This is a unique Labor Operation for Bulletin use only.	
<i>Version</i>		2
<i>Modified</i>		4/18/2017 to update Parts Information

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2015-2017-corvette-z06-service-bulletin-pip5455a-lt4-supercharger-belt-tensioner-noise-with-a-light-tip-in-afm-1357.html>