

2015 - 2017 Corvette Z06: Service Bulletin: #PIP5455A: LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM

#PIP5455A: LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM - (Apr 18, 2017)

Subject:				LT4 Supercharger Belt Tensioner Noise with A light Tip In AFM			
Brand:	Model:	Model Year:		VIN:		Engine:	Transmi ssion:
		from	to	from	to		
Cadillac	CTS-V	2016 - 2017		All	All	6.2L LT4	All
Chevrol et	Camaro	2017		All	All	6.2L LT4	All
Chevrol et	Corvett e	2015 - 2017		All	All	6.2L LT4	All

<i>Involved Region or Country</i>	North America
<i>Additional RPO/s:</i>	6.2 LT4
<i>Condition</i>	There may be a concern with a rattle or flutter noise from the supercharger tensioner and belt. This occurs in V4 mode with light throttle conditions. Issue sounds like tick noise when in driver seat.

	This seems to vary between vehicles but replacing the tensioner won't resolve the issue.
<i>Cause</i>	The supercharger belt tensioner will jump and cause the noise

Correction

Replace the supercharger belt with a Gates Belt P/N K080852HD

Parts Information

Description	Part Number	Qty
K080852HD	Supercharger Belt	1

Warranty Information

Labor Operation	Description	Labor Time
4062850	Supercharger Belt Replacement	Use Published labor time
	*This is a unique Labor Operation for Bulletin use only.	
<i>Version</i>	2	
<i>Modified</i>	4/18/2017 to update Parts Information	

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2015-2017-corvette-z06-service-bulletin-pip5455a-lt4-supercharger-belt-tensioner-noise->

[with-a-light-tip-in-afm-1357.html](#)