

2020 Corvette Service Bulletin: #PIP5752B: Service Engine Light misfire engine noise With DTC P0300 P0106 P0506 - Possible Valve Stem - (Oct 13, 2020)

#PIP5752B: Service Engine Light misfire engine noise With DTC P0300 P0106 P0506 - (Oct 13, 2020)

Subject:			Service Engine Light misfire engine noise With DTC P0300 P0106 P0506				
Brand:	Model:	Model Year: from to	VIN: from to		Engine:	Transmis sion:	
Cadillac	Escalade	2021	All	All	6.2 L87	All	
Chevrole t	Camaro	2020 - 2021	All	All	6.2 LT1 LT4	All	
Chevrole t	Corvette	2020	All	All	6.2 LT2	All	
Chevrole t	Silverado	2020	All	All	5.3 L82 L84 6.2 L87 6.6 L8T	All	
Chevrole t	Suburban	2021	All	All	5.3 L846.2 L87	All	
Chevrole t	Tahoe	2021	All	All	5.3 L846.2 L87	All	
GMC	Sierra	2020	All	All	5.3 L82 L84 6.2 L87 6.6 L8T	All	

GMC	Yukon	2021	All	All	5.3 L84	All
					6.2 L87	

***Involved Region or Country
Condition***

North America
A Vehicle may have a concern of service engine light, misfire and engine noise with possible of DTC P0300 P0106 P0506.

Cause

Possible broken valve spring.

Correction

During inspection if you determine that the engine has a broken valve spring it will be necessary to perform a cylinder leakage test on the affected cylinder.

If no cylinder leakage is observed it will be necessary to replace all valve springs on both banks if the vehicle is built between June 1, 2020 to September 15, 2020. Note: This only applies to the 6.2L engines RPOs L87, LT1, LT4 and LT2. For all other engine RPOs L82, L84 and L8T just replace the affected valve spring.

If you determine that engine has cylinder leakage it will be necessary to inspect further to determine the extent of the engine damage to determine correct repair required.

Important: All valve springs will be requested back for further analysis and inspection.

Warranty Information

For vehicles repaired under the Powertrain coverage, use published labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Version

3

Modified

09/08/2020 - Created on.

09/21/2020 - Updated to add 2020 Chevrolet Camaro and edit the correction statement.

10/13/2020 - Updated Model Years.

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2020-corvette-service-bulletin-pip5752b-service-engine-light-misfire-engine-noise-with-dtc-p0300-p0106-p0506-possible-valve-stem-oct-13-2020-1460.html>