2005 - 2009 Corvette: Service Bulletin: Snap, Pop or Rattle Noise From Lift Off Roof Panel While Driving

Bulletin #: 08.08.67.013A

Subject: Snap, Pop or Rattle Noise From Lift Off Roof Panel While Driving (Replace Front Lift Off Roof Panel Handles and Lube)

Models: 2005-2009 Chevrolet Corvette with Removable Clear Roof Panel (RPO CC3), Removable Sun Roof Panel (RPO CF7) or Dual Removable Roof Panels (RPO C2L)

Condition

Some customers may comment on a snap, pop or rattle noise coming from the lift off roof panel while driving.

Cause

This condition may be caused by the nylon roller inside the left and/or right front roof panel latching handle becoming loose and causing the roller to move on the pin, creating the noise.

Correction

Replace the left and right front lift off roof panel handles (1) and lube. Refer to Roof Lift Off Panel Front Latch Handle Replacement in SI. The updated handles have a new design ramp insert in place of the nylon roller.

Technicians are to apply GM Super Lube® with PTFE, P/N 12371287 (in Canada, P/N 10953437) to both sides (left and right) at the following areas:

Apply GM Super Lube® around the entire guide pin ball (1) on the roof panel.

Apply GM Super Lube® inside the "pocket" of the stainless steel track (1).

19206591 Handle, Roof Lift Off Panel - Left

19206592 Handle, Roof Lift Off Panel - Right

12371287 (US)
GM Vehicle Care Super Lube® with PTFE

General Motors bulletins are intended for use by professional technicians, not a "do-it-yourselfer". They are written to inform those technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See a General Motors dealer servicing your brand of General Motors vehicle for information on whether your vehicle may benefit from the information.

© Copyright General Motors Corporation. All Rights Reserve

Online URL:

https://www.corvetteactioncenter.com/tech/knowledgebase/article/2005-2009-corvette-service-bulletin-snap-pop-or-rattle-noise-from-lift-off-roof-panel-while-driving-154.html