

# 1997 - 1998 Corvette: Service Bulletin: Reduced Engine Power Message Along With Partic. Powertrain

**Subject:** REDUCED ENG. POW. MESSAGE ALONG W/ PARTIC. PWRTRAIN

**Source:** Chevrolet Dealer Technical Service Bulletin

**Number:** 87-65-16

**Models:** 1997-98 CHEVROLET CORVETTE WITH 5.7L V8 ENGINE (VIN G - RPO LS1)

## Condition

CONDITION #1: INTERMITTENT REDUCED ENGINE POWER EVENT, ACCOMPANIED BY P-1516, OR P1518 TROUBLE CODES.

IF A SITUATION ARISES WHERE A P-1516 TROUBLE CODE IS ACCOMPANIED BY A

P-1120 AND/OR P-1220 TROUBLE CODE, THIS SERVICE BULLETIN DOES NOT APPLY. IN THESE CASES THE TECHNICIAN MUST USE THE NORMAL STRATEGY BASED DIAGNOSTIC.

CONDITION #2: INTERMITTENT REDUCED ENGINE POWER ACCOMPANIED BY TROUBLE CODE P-1125 AND ANY OF THE FOLLOWING TROUBLE CODES:

P-1276 P-1281 P-1286

## Cause

CONDITION MAY BE DUE TO DIAGNOSTIC SOFTWARE AND CALIBRATION IN THE TAC-MODULE WERE NOT OPTIMALLY UTILIZED.

## Correction

IF THE ABOVE CONDITIONS CANNOT BE CORRECTED USING THE NORMAL STRATEGY BASED DIAGNOSTICS LISTED IN THE SERVICE MANUAL,

INSTALL THE NEW TAC- MODULE LISTED BELOW.

### **Parts Information**

NEW TAC-MODULE PART # 25319443

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1997-1998-corvette-service-bulletin-reduced-engine-power-message-along-with-partic-powertrain-402.html>