

2001 Corvette: Service Bulletin: Incomplete Brake Pedal Return

Model Year: 2001 Corvette

Subject: Incomplete Brake Pedal Return - (Replace Vacuum Brake Booster)

Source: Chevrolet Dealer Service Technical Bulletin

Number: 01-05-22-002

Date: April, 2001

Condition:

Some owners may comment that after the brake pedal is released, the brakes appear to remain partially applied (light brake drag) and/or that the brake lights remain illuminated.

Cause:

Condition may be due to vacuum brake boosters assembled with return springs that may exhibit inadequate force to completely return the brake pedal after a brake apply.

Correction:

Replace the existing vacuum brake booster with a new booster, P/N 18046267, following the procedure contained in the applicable Service Manual.

Parts Information:

Number: 18046267

Description: Vacuum Brake Booster

Parts are currently available from GMSPO.

Online URL: <https://www.corvetteactioncenter.com/tech/knowledgebase/article/2001-corvette-service-bulletin-incomplete-brake-pedal-return-449.html>