

# 1997 - 1999 Corvette: Service Bulletin: Loose or Missing Headlamp Door Bezel Plug

**Subject:** Loose or Missing Headlamp Door Bezel Plug (Install New Bezels and Plugs)

**Source:** Chevrolet Dealer Technical Service Bulletin

**Number:** 99-08-42-005

**Models:** 1997-99 Chevrolet Corvette


This bulletin is being revised to add the 1999 model year, update part numbers, service procedures, labor operations and labor times. Please discard Corporate Bulletin Number 83-82-07 (Section 8 - Chassis/Body Electrical)

## Condition

Some customers may comment that the plastic plug that covers the headlamp aiming adjustment screw on the inboard side of the headlamp door bezel is loose or missing.

## Correction

Two different size plugs have been used in production. Early production 1997 vehicles used a plug with a diameter of 24 mm (15/16 in), while later 1997 vehicles and all 1998 and 1999 vehicles use a larger 54 mm (2 1/8 in) diameter plug. Both size plugs have been replaced by a new design plug and, therefore, will no longer be available.

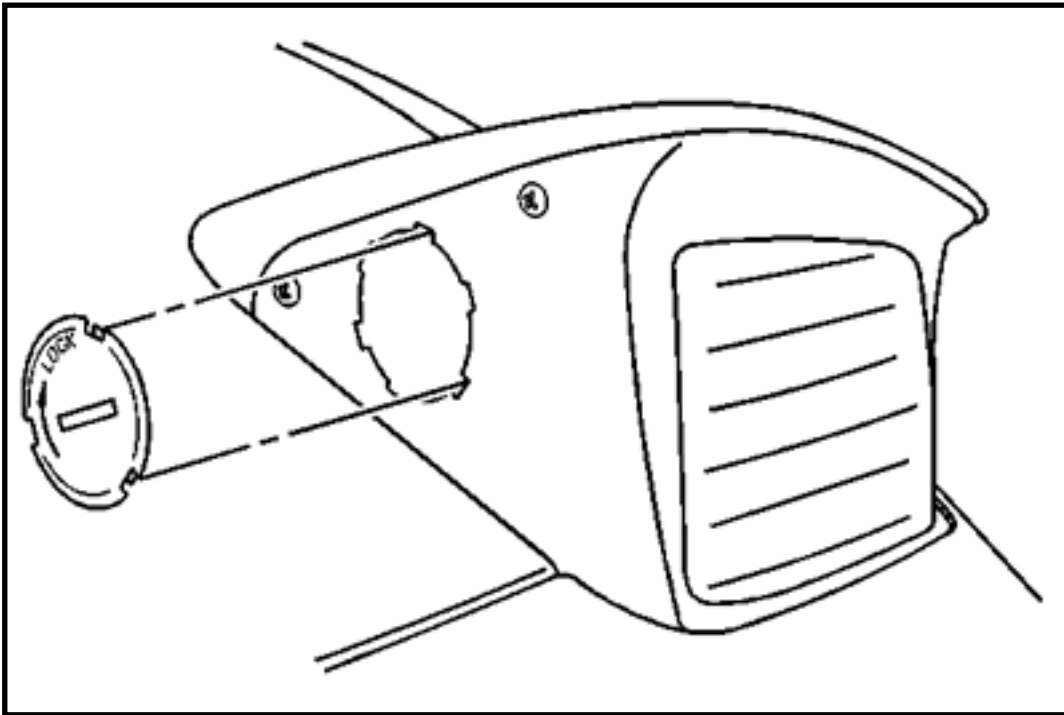

Using the following service procedure, replace both the left and right headlamp bezels with the new design bezels that have a large NOTCHED hole. The notched hole is required for installing a new design NOTCHED plug.

### **Service Parts Information**

1. Open the engine compartment hood.
2. Turn the headlamp switch to the ON position (the headlamp doors will open and the lamps will illuminate).
3. Turn the headlamp switch back to the PARK lamp setting (headlamp doors will remain open).
4. Remove and discard both the left and the right headlamp bezels and plugs, following the information in the Body & Accessories section of the appropriate Service Manual.
5. Install the new left and right headlamp bezels.
6. Align the notches on the new plug with the notches in the opening in the new headlamp bezel.
7. Using a quarter or a flat-bladed screwdriver, slowly rotate the plug in

the direction shown by the arrow on the outside of the plug until a click can be heard or felt.

8. Repeat steps 6 & 7 on the other headlamp bezel.
9. Turn the headlamp switch to the OFF position (headlamp doors will close).
10. Close the engine compartment hood.

Part Number	Description	Pkg. Qty.	Qty. Required Per Vehicle
10435410	Plug	2	2 (1 Per Bezel)
10435411	Bezel, Headlamp - Left	1	1
10435412	Bezel, Headlamp - Right	1	1

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1997-1999-corvette-service-bulletin-loose-or-missing-headlamp-door-bezel-plug-467.html>