1997 - 1998 Corvette: Service Bulletin: Hiss Type Noise Coming From Weatherstrip When Closing Right or Left Door

Subject: HISS TYPE NOISE COMING FROM WEATHERSTRIP WHEN CLOSING

RIGHT AND/OR LEFT DOOR (ADD RELIEF HOLE)

Source: Chevrolet Dealer Technical Service Bulletin

Number: 83-15-07

Models: 1997-1998 Chevrolet Corvette Coupe and 1998 Chevrolet Corvette

Convertible

Condition: SOME CUSTOMERS MAY COMMENT ON A HISS TYPE NOISE COMING FROM THE WEATHERSTRIP WHEN CLOSING THE RIGHT AND/OR LEFT DOOR WITH THE GLASS IN THE FULL UP POSITION.

Correction:


- 1. REMOVE THE WEATHERSTRIP ABOVE THE DOOR GLASS AND CUT AN AIR RELIEF HOLE 3MM WIDE (.12 IN) BY 10MM LONG (.4 IN) IN THE BACK OF THE WEATHERSTRIP.
- 2. RESEAL THE FRONT AND REAR CORNERS ON THE COUPE OR THE FRONT CORNER OF THE CONVERTIBLE WITH WEATHERSTRIP ADHESIVE; 3M(R) P/N 08011, OR EQUIVALENT. SEE FIGURE 1.
- 3. REINSTALL WEATHERSTRIP.

WARRANTY INFORMATION:

FOR VEHICLES REPAIRED UNDER WARRANTY, USE:

LABOR OPERATION LABOR OPERATION NUMBER DESCRIPTION TIME

C1420/C1421 WEATHERSTRIP - ALIGN OR REPLACE 0.3 HR
C1715/C1716 WEATHERSTRIP SIDE RAIL (FRONT) 0.2 HR REPLACE

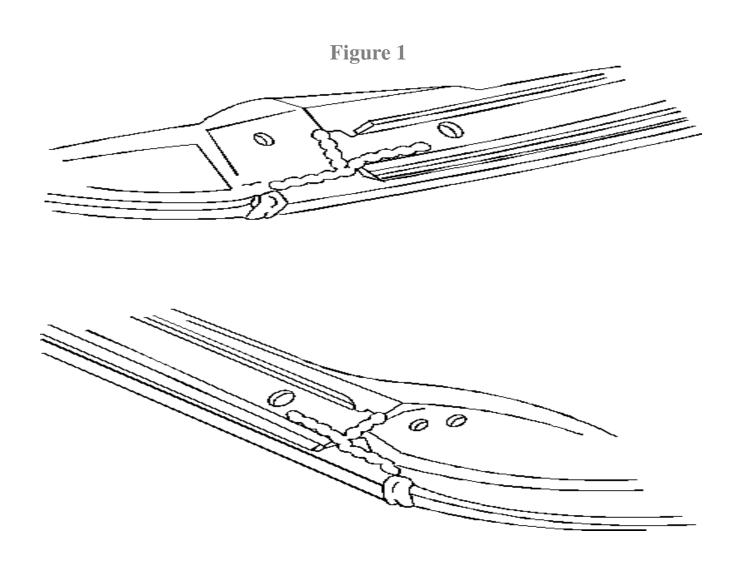

GM bulletins are intended for use by professional technicians, NOT a "do-it-

yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

COPYRIGHT 1997 GENERAL MOTORS CORPORATION. ALL RIGHTS RESERVED

Online URL:

https://www.corvetteactioncenter.com/tech/knowledgebase/article/1997-1998-corvette-service-bulletin-hiss-type-noise-coming-from-weatherstrip-when-closing-right-or-left-door-472.html