

# **2007 - 2009 Corvette: Service Bulletin: Headliner Wear (Replace Bolts and Remove Sharp Edge)**

---

**#08-08-110-001A:** Headliner Wear (Replace Bolts and Remove Sharp Edge)  
- (Jun 17, 2008)

**Subject:** Headliner Wear (Replace Bolts and Remove Sharp Edge)

**Models:** 2007-2009 Chevrolet Corvette

## **Condition #1**

Some customers may comment that the headliner has some wear damage on the outer edges along the upper trim.

## **Condition #2**

Some customers may comment on small holes in the rear corners of the headliner.

## **Cause #1**

This condition may be caused by a sharp edge on the outer headliner trim, causing the wear.

## **Cause #2**

This condition may be caused by four pins and retainers. Two per side (1) Or sharp edges (2) from the convertible top mechanism, which may be wearing small holes in the rear corners of the headliner when it is stowed.

## **Correction #1**

Round off the inner top edge of the headliner trim and replace the headliner following the procedure below.

## **Correction #2**

Remove the headliner and replace the four aluminum pins and retainers. There are two pins and two retainers per side. Also check the convertible top linkage for sharp edges. Sand down all sharp edges and paint as necessary. Replace the headliner following the procedure listed below.

General Motors bulletins are intended for use by professional technicians, not a "do-it-yourselfer". They are written to inform those technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See a General Motors dealer servicing your brand of General Motors vehicle for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2007-2009-corvette-service-bulletin-headliner-wear-replace-bolts-and-remove-sharp-edge-56.html>