

# 1982 Corvette: Service Bulletin: Spark Plug Fouling/Driveability Improvements

**Subject:** SPARK PLUG FOULING/DRIVEABILITY IMPROVEMENTS - 1982 CORVETTE WITH FEDERAL EMISSIONS

**Model and Year:** 1982 Corvette with Federal Emissions

**Source:** Chevrolet Dealer Service Technical Bulletin

**Bulletin Number:** 82-T-101

**Number:** VI

**Section:** Aug., 1982

TO: ALL CHEVROLET DEALERS

A new PROM has been released for the 1982 Corvette to reduce the possibility of spark plug fouling and to enhance driveability. This new PROM leans the fuel calibration during cold engine operation and unlocks the torque converter at a lower throttle opening.

	NEW
ECM	16029531
PROM Identification	391A36
Service Prom	1226096

In addition, check spark plugs for fuel fouling and replace if necessary. Use care when removing spark plug wire boots from spark plugs. Twist the boot one-half turn before removing, and pull on the boot only to remove the wire. Check to make sure plug wires are routed correctly and through the proper retainers.

Use applicable labor operations.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1982-corvette-service-bulletin-spark-plug-fouling-driveability-improvements-674.html>