

1968 Corvette: Service Bulletin: Lubrication of Window Regulator Shaft

Model Year: 1968

Subject: LUBRICATION OF WINDOW REGULATOR SHAFT - 1968 CORVETTE

Source: Chevrolet Dealer Service Technical Bulletin

Number: 68-T-15

Section: I

Date: Jan. 10, 1968

To: ALL CHEVROLET DEALERS

Difficulty in raising and lowering the door windows may be experienced on some 1968 Corvettes built prior to 10-31-67. This condition is caused by lack of lubrication between the regulator shaft and the regulator housing (see 1968 Chassis Service Manual, Page 1B-21, Figure 35, Item 6). Galling and metal pick-up on the shaft, due to lack of lube, results in a binding condition of the window regulator assembly.

If the above condition is encountered, inspect both door regulators assembly for proper lubrication. In most cases, the housing should be replaced; however, if galling or metal pick-up on the shaft is slight, the shaft can be repaired by polishing with Crocus Cloth and applying a thin coat of Lubriplate (Part No. 1050109 or Part No. 1050110), or equivalent, for proper lubrication.

PARTS AND LABOR DATA

| | QUA. | PART NO. | PART DESCRIPTION | P | FC | L | T | OPERATION NO. |
|----|------|-------------|-------------------|---|----|---|---|---------------|
| 1. | 1 | 392158 3 | Housing - L.H. | | 52 | X | | 014261 90 |
| 2. | 1 | 392158 | Shaft | | | | | |

| | | | | | | | | |
|----|---|-------------|-------------------|--|----|---|--|--------------|
| | | 0 | | | | | | |
| 3. | 1 | 392158 4 | Housing - R.H. | | 52 | X | | 014260 90 |
| 4. | 1 | 392158 0 | Shaft | | | | | |

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1968-corvette-service-bulletin-lubrication-of-window-regulator-shaft-719.html>