

# 1965 Corvette: Service Bulletin: Corvette Hood Flutter With 425 H.P. Engine

**Subject:** 1965 Corvette Hood Flutter With 425 H.P. Engine

**Model and Year:** 1965 Corvettes

**Source:** Chevrolet Service Bulletin

**Number:** 15

**Zone:** #41 - Wichita

**Date:** July 20, 1965

Owners of early Corvettes with the 425 H.P. engine may experience hood flutter or, in extreme cases, hood rapping on the radiator support.

The rapping noise can be corrected and the flutter reduced considerably by cementing a 1-1/2 foot length of rubber seal, Part No. 3827365, to the top of the radiator support to insulate the points of hood contact.

An identical fix went into production on vehicles built after serial number S116736.

R. G. Jordan  
Zone Service Manager

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1965-corvette-service-bulletin-corvette-hood-flutter-with-425-h-p-engine-752.html>