

# 2014 - 2020 Corvette: Service Bulletin: #17-NA-271: Clicking Noise from Front Wheels While Turning at Slow Speeds

## #17-NA-271: Clicking Noise from Front Wheels While Turning at Slow Speeds - (Oct 13, 2020)

**Subject:** Clicking Noise from Front  
Wheels While Turning at Slow  
Speeds

This bulletin replaces PI1498C. Please discard PI1498C.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmissi on:
		from	to	from	to		
Buick	Enclave	2012	2021	—	—	All	All
Cadillac	XT5	2017					
	XT6	2020					
Chevrolet	Blazer	2019					
	Camaro	2016					
	Corvette	2014	2020				
	Traverse	2012	2021				
GMC	Acadia	2012					

### *Involved Region or Country*

North America, Europe, Russia, Middle East, Israel, Argentina, Brazil, Bolivia, Chile, Colombia, Ecuador, Paraguay, Peru, Uruguay, Japan, GM Korea Company, China, Taiwan, Philippines

### *Condition*

Some customers may comment on a clicking noise emanating from the front wheels location. This condition may be more predominant at low speeds (16-32 km/h (10-20 mph) during full wheel lock turns on dry clean pavement.

### *Cause*

This may be caused by interaction between the wheel mounting face and the wheel mounting surfaces on the brake rotor.

### *Correction*

Clean both of the wheels mounting surfaces.

### **Service Procedure**


**Important:** *DO NOT* replace the wheels or brake rotors for this condition.

If you encounter a vehicle with the above concern, follow the procedure below.

1. Remove both of the front wheels. Refer to *Tire and Wheel Removal and Installation* in SI.
2. Clean both of the wheel mounting surfaces as follows.
  - Using a clean cloth dampened with approved brake cleaner (ex. Part number 19370705 (U.S.), 88901247 (Canada)), wipe the mounting surface of the wheel(s) removing any residual grey or black material that has accumulated on the wheel mounting surfaces.

**Note:** All cleaning must be done by hand. *DO NOT* use pneumatic or power tools.


- Clean the wheel mounting surface of the brake rotors, or sometimes referred to as the brake rotor top hats, as follows:

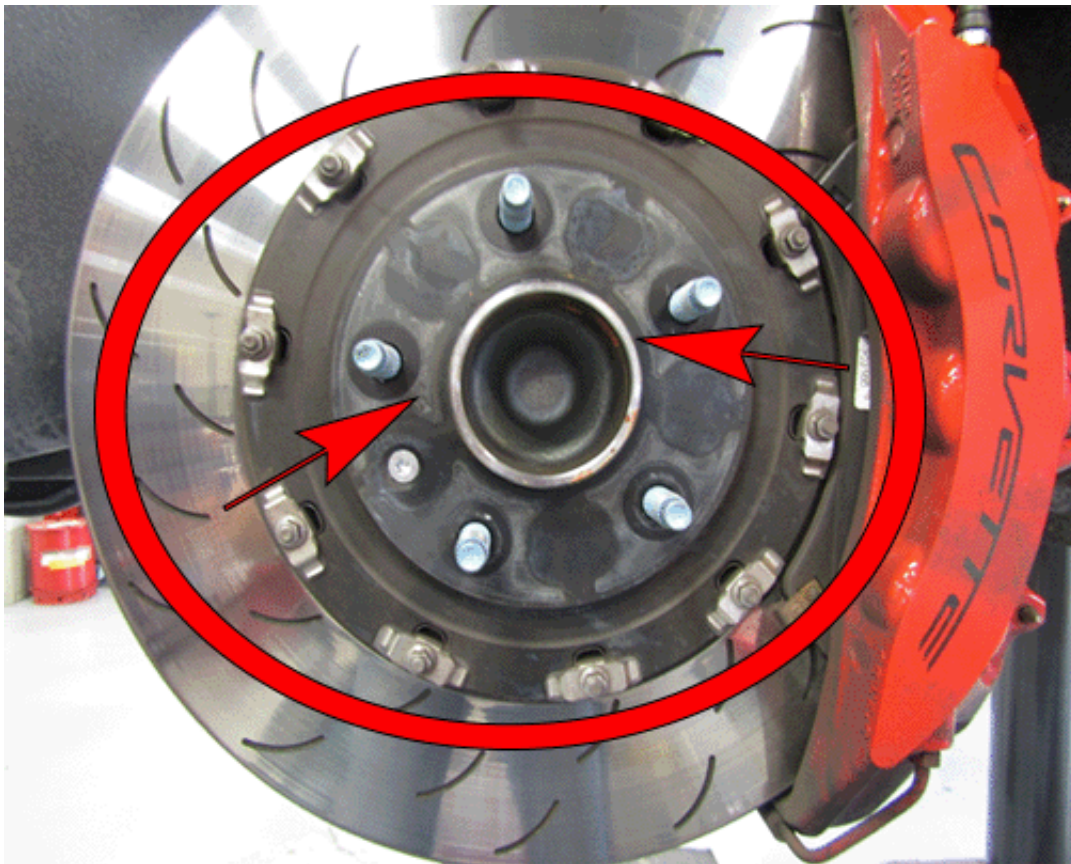

- Using 3M red Scotch-Brite 7447 pad or equivalent with approved brake cleaner (ex. Part number 19370705 (U.S.), 88901247 (Canada)), wipe the wheel mounting surface of the rotor (brake rotor top hat) and the wheel pilot at the center of the

rotor, removing any residual grey or black material that has accumulated on the rotors.

**Note:** All cleaning must be done by hand. *DO NOT* use pneumatic or power tools.

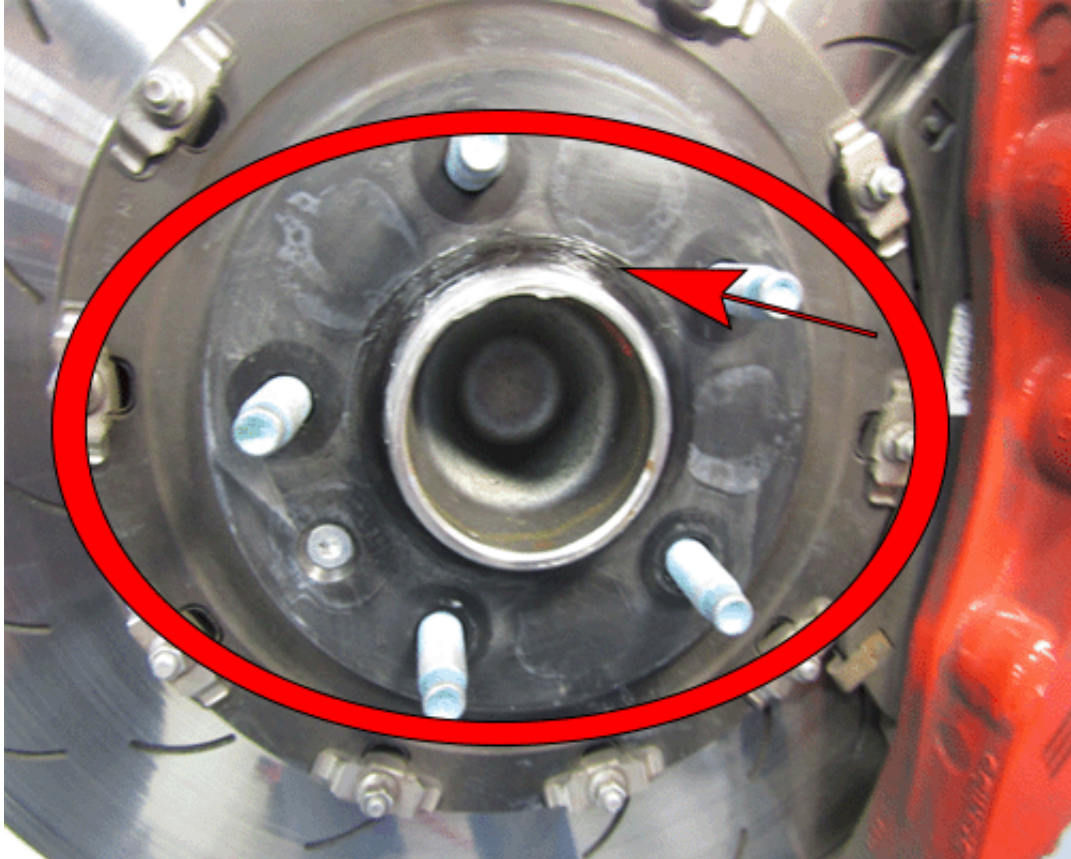

- Using Super Lube paste, P/N 12371287 (in Canada, 10953437) or equivalent, apply a light coat around the center pilot of the hub *ONLY*.
- Reinstall both of the wheels using the original wheel nuts. Refer to *Tire and Wheel Removal and Installation* in SI.

### **Tighten**

Tighten Refer to Fastener Specifications in SI for proper wheel nut torque specifications.

**Important:** Be sure the wheels and rotors are thoroughly dry prior to installation.

### **Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
8080168*	Clean Mating Surfaces of Wheels and Rotors Due to Clicking Noise	0.7 hr

\*This is a unique Labor Operation for bulletin use only.

*Version*

9

*Modified*

October 06, 2017 – Added the Cadillac XT5.

October 19, 2018 – Updated step 3 and added pictures.

November 15, 2018 – Added 2019 Model Years and updated part number for Super Lube in U.S.

January 10, 2019 – Updated the U.S. part numbers for brake cleaner in Step 2 and Super Lube.

February 07, 2019 – Added the 2019 Chevrolet Blazer.

August 23, 2019 – Added certain 2020 Model Year vehicles.

July 21, 2020 – Added the 2020 Chevrolet Blazer.

August 07, 2020 – Added the 2020 Chevrolet Corvette and updated the Involved Region or Country section.

October 13, 2020 – Added the 2021 Model Year and updated the Involved Region or Country section.

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2014-2020-corvette-service->

[bulletin-17-na-271-clicking-noise-from-front-wheels-while-turning-at-slow-speeds-1431.html](#)