

# 2014 - 2020 Corvette: Service Bulletin: #16-NA-059: Staining/Discoloring to Brake Caliper Paint - (Oct 14, 2020)


## #16-NA-059: Staining/Discoloring to Brake Caliper Paint - (Oct 14, 2020)

Subject:				Staining/Discoloring to Brake Caliper Paint			
Brand:	Model:	Model Year:		VIN:		Engine:	Transmis sion:
		from	to	from	to		
Cadillac	ATS-V	2016	2018	—		All	All
	CTS-V	2016	2018				
Chevrolet	Camaro	2012	2021				
	Corvette	2014	2020				

### *Involved Region or Country*

North America, Europe, Russia,  
Middle East, Israel, Argentina, Brazil,  
Bolivia, Chile, Colombia, Ecuador,  
Paraguay, Peru, Uruguay, Japan, GM  
Korea Company, China, Taiwan,  
Philippines

### *Condition*

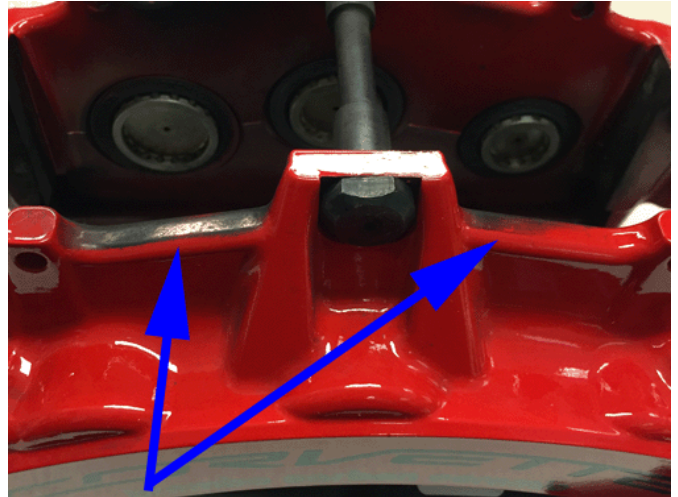


*Cause*

Some customers may comment on a discoloration or black stain on the paint of the brake calipers. This may be caused by high brake pad temperatures during aggressive driving or track event tarnishing the caliper paint.

**Correction**

**Important:** Do *NOT* replace the brake calipers for this condition.

This is not a defect in the paint or the caliper.

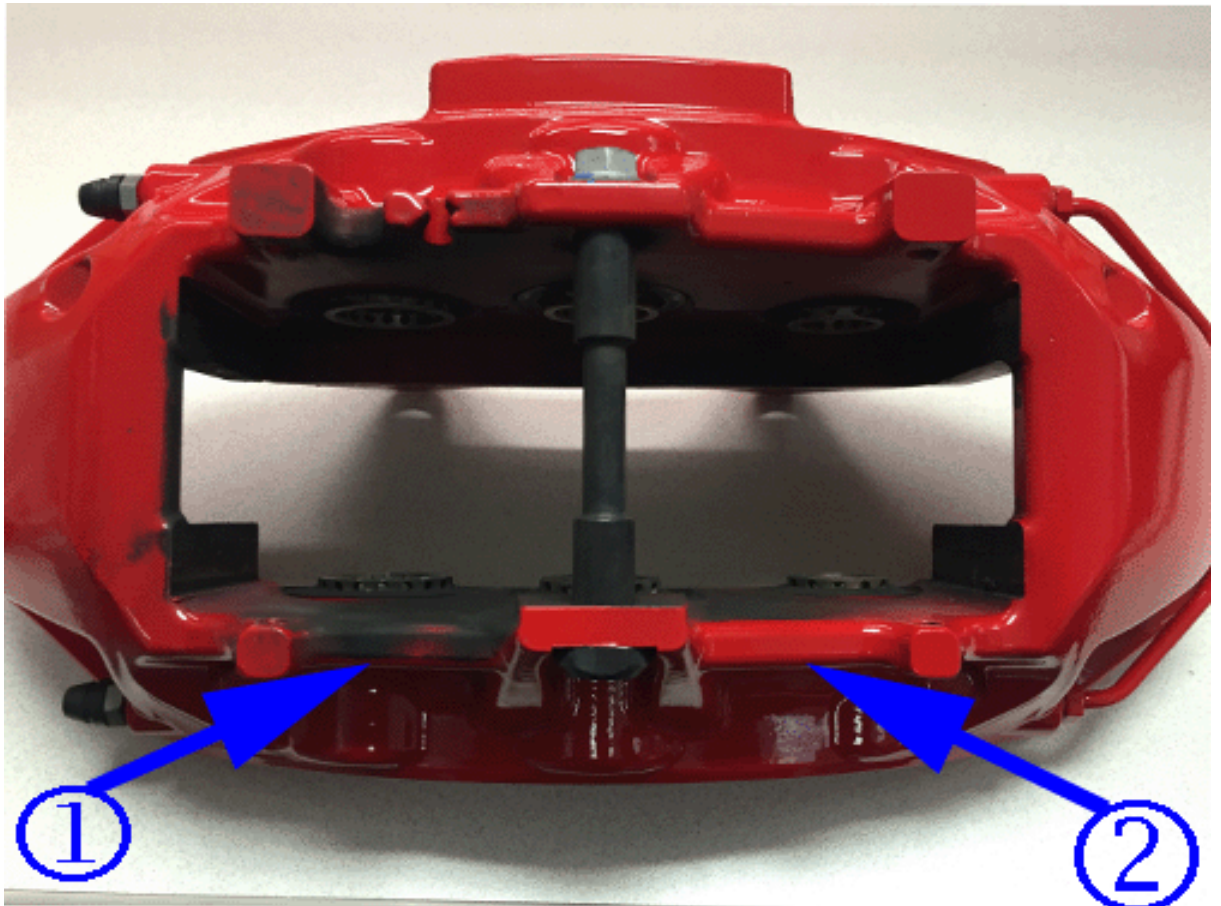

- |     |   |
|-----|---|
| (1) | Not cleaned using mild polishing compound |
| (2) | Cleaned using mild polishing compound     |

If the customer wishes to have the black stain removed, a very mild polishing compound can be used to remove the stain.

**Important:** Do NOT use harsh chemicals or brake cleaner to attempt

to remove the stain. This could damage the paint on the caliper.

*Version*

3

*Modified*

May 30, 2017 – Updated the Models and Model Years.

October 14, 2020 – Updated the Models, Model Years and updated formatting to remove Attention statement and add the Involved Region or Country section.

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2014-2020-corvette-service-bulletin-16-na-059-staining-discoloring-to-brake-caliper-paint-oct-14-2020-1457.html>