

# 1998 - 2001 Corvette Convertible: Service Bulletin: Squeak From Rear of Convertible Top (Replace Protector Assembly)

**Source:** Chevrolet Dealer Service Bulletin

**Number:** 01-08-67-003


**Subject:** Squeak From Rear of Convertible Top (Replace Protector Assembly)

**Model Year:** 1998-2001 Corvette

## Condition

Some customers may comment on a squeak coming from the rear of the convertible top.

## Cause

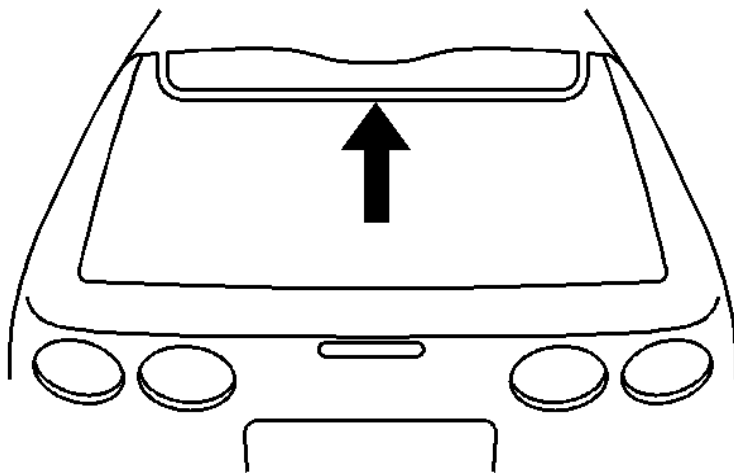

This condition may be caused by interference between the fifth bow seal and the tonneau cover rub strip. (Refer to the illustration above).

## Correction

1. Remove the old seal.
2. Remove any two way tape from the body.
3. Clean the surface.
4. Install a new front top stow compartment lid protector assembly.

### Parts Information

Part Number	Description
10313384	Front Top Stow Compartment Lid Protector Assembly

Parts are currently available at GMSPO.

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
B3700	Applique and/or Protector Stowage Lid Replace	0.3 hr

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1998-2001->

[corvette-convertible-service-bulletin-squeak-from-rear-of-convertible-top-replace-protector-assembly-459.html](#)