

# 1968 Corvette: Service News: Corvette Folding Top Compartment Lid to Folding Top Interference (SN-68-20)

---

**Subject:** Corvette Folding Top Compartment Lid to Folding Top Interference (SN-68-20)


**Model and Year:** 1968 Corvette

**Source:** Chevrolet Service News

**Page Number:** NA

**Date:** April 1968, Volume 40, Issue Number 4

It has been found that the rear compartment lid on some 1968 Corvettes interferes with the convertible top when the top is being raised or lowered. This interference is easily eliminated by filing approximately 1/8" off the existing hinge stops (right and left side). Removing 1/8" from the hinge stops, as shown in Figure 12, allows the rear compartment lid to raise farther thus eliminating the interference condition. The stops referred to are simply tabs that has been punched out of the hinge support members.

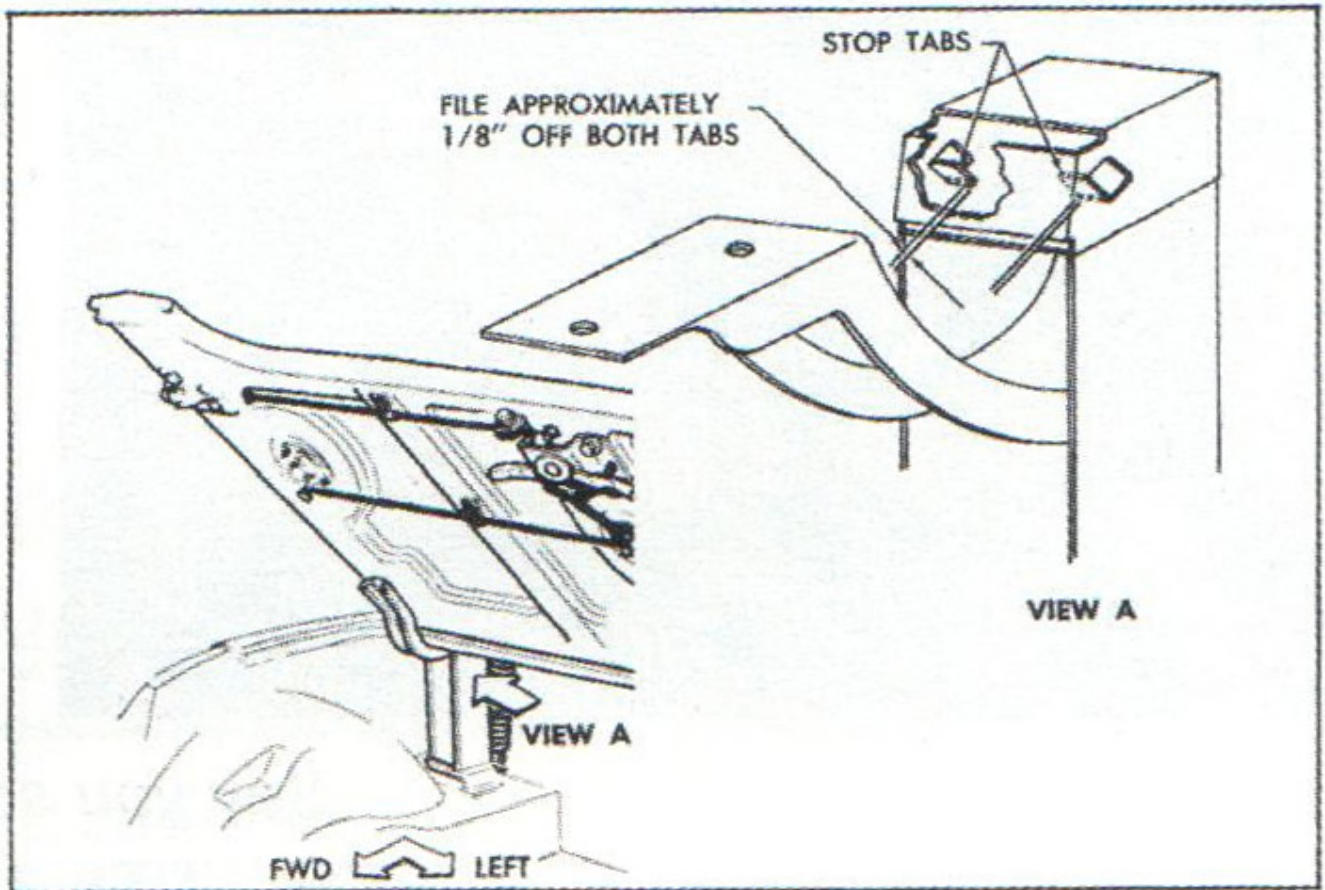

**Fig. 12—Remove  $\frac{1}{8}$ " From Lid Stops**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1968-corvette-service-news-corvette-folding-top-compartment-lid-to-folding-top-interference-sn-68-20-872.html>